

## VFDSoft Installation


Install the VFDSoft USB driver execution file manually step by step:

Step 1: Download and install the latest version of VFDSoft which is compatible to V1.542 and above.

Download link: 

Step 2: Open the file browser, and enter the installation path of VFDSoft.


Installation path: C: > Program Files (x86) > Delta Industrial Automation > AC Motor Drive > VFDSoft > DeltaDriver

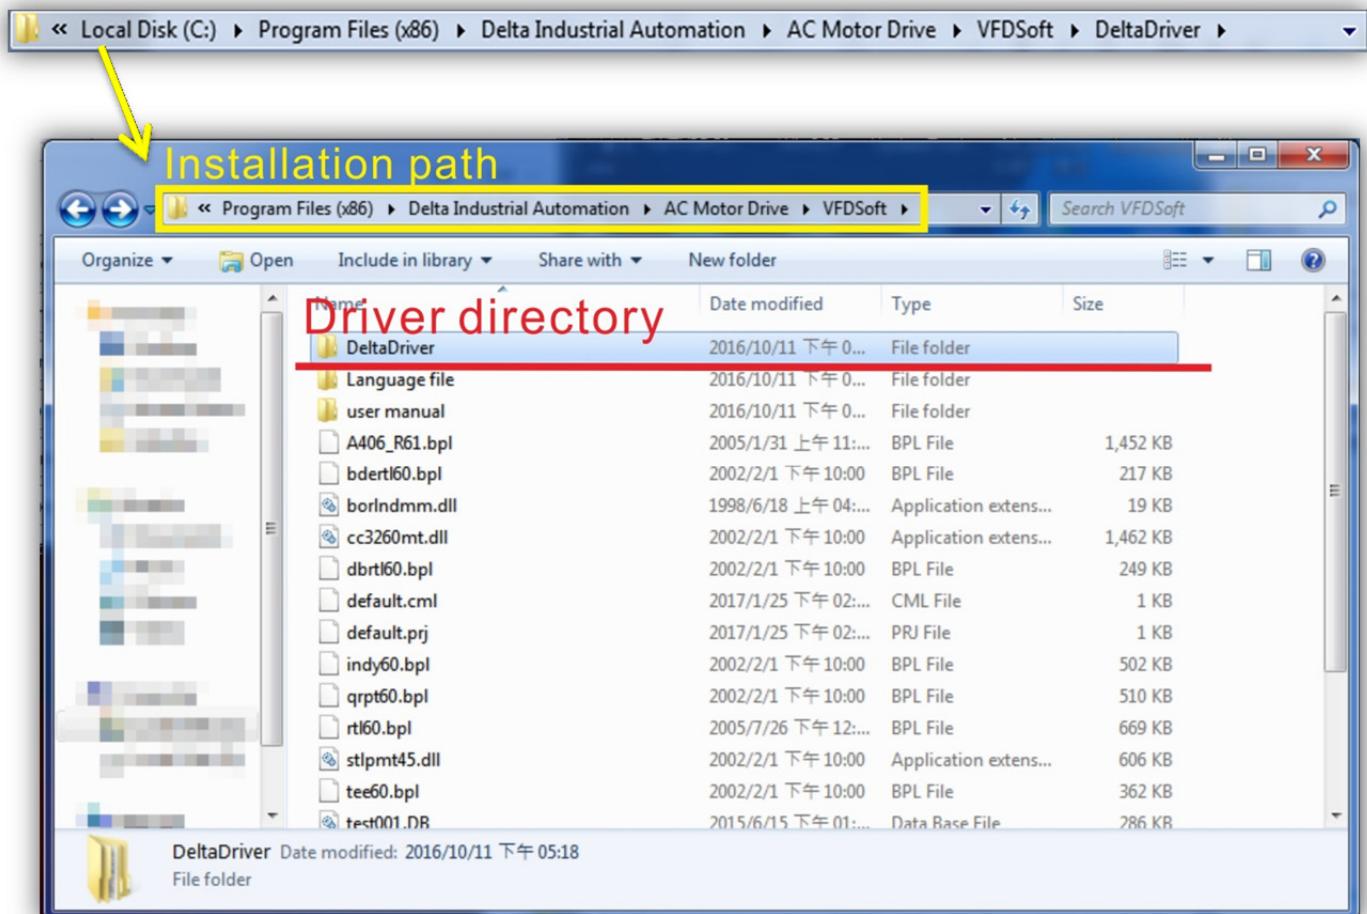

Step 3: Choose your OS version.

x86 (32 bit): Proceed to Step 3.1

x64 (64 bit): Proceed to Step 3.2



Step 3.1: Choose x86 and execute dpinst.exe. Ignore all warning messages and click “YES” till the end.

CDC_Demo.inf	2016/8/31 上午 1...	安裝資訊	2 KB
CDC_Demo_Win7.inf	2016/8/31 上午 0...	安裝資訊	3 KB
CDC_Demo_Win7_sh.inf	2016/8/31 上午 1...	安裝資訊	3 KB
dpinst.exe	2008/8/26 下午 0...	應用程式	538 KB
serenum.sys	2008/4/15 下午 0...	系統檔案	16 KB
silabenm.sys	2014/4/12 上午 0...	系統檔案	16 KB
silabser.sys	2014/4/12 上午 0...	系統檔案	67 KB
slabvcp.cat	2014/4/12 上午 0...	安全性目錄	12 KB
slabvcp.inf	2014/4/12 上午 0...	安裝資訊	5 KB
usbser.sys	2008/4/14 上午 1...	系統檔案	26 KB

Step 3.2: Choose x64 and execute dpinst64.exe. Ignore all warning messages and click “YES” till the end.

CDC_Demo.inf	2016/8/31 上午 1...	安裝資訊	2 KB
CDC_Demo_Win7.inf	2016/8/31 上午 0...	安裝資訊	3 KB
CDC_Demo_Win7_sh.inf	2016/8/31 上午 1...	安裝資訊	3 KB
dpinst64.exe	2014/12/14 下午 ...	應用程式	1,023 KB
serenum.sys	2008/4/15 下午 0...	系統檔案	16 KB
silabenm.sys	2014/4/12 上午 0...	系統檔案	23 KB
silabser.sys	2014/4/12 上午 0...	系統檔案	78 KB
slabvcp.cat	2014/4/12 上午 0...	安全性目錄	12 KB
slabvcp.inf	2014/4/12 上午 0...	安裝資訊	5 KB
usbser.sys	2008/4/14 上午 1...	系統檔案	26 KB

Step 4: Connect AC motor drive to the computer, then open Device Manager to check if the USB COM Port is now “CDC USB Demonstration”.

